
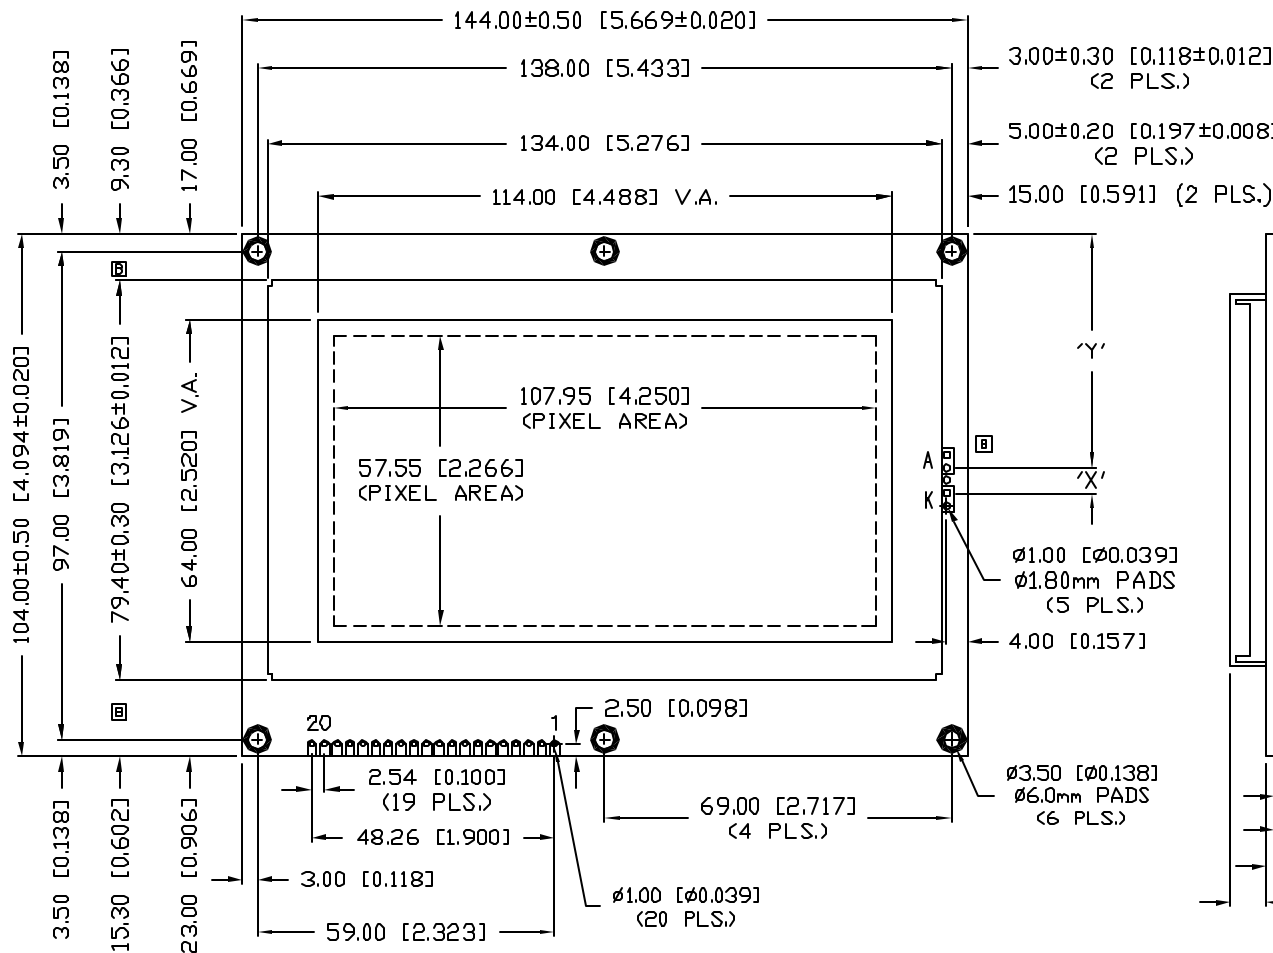


UNCONTROLLED DOCUMENT

P/N PREFIX/SUFFIX TABLE		
LCM-X	GXX	DESCRIPTION
STANDARD	S	SR STN, REFLECTIVE
	S	SF STN, TRANSFLECTIVE W/LED BACKLIGHT
HIGH TEMP.	H	WF-C FSTN, TRANSFLECTIVE W/CCFL BACKLIGHT
	H	WF-L FSTN, TRANSFLECTIVE W/WHITE EL BACKLIGHT

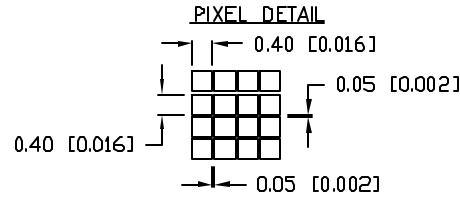


PART NUMBER
LCM-X240128GXX(-X)

REV.

B

REV.	E.C.N. NUMBER AND REVISION COMMENTS	DATE
A	E.C.N. #10BRDR. & REDRAWN.	9-10-98
B	E.C.N. #10516.	5-10-99

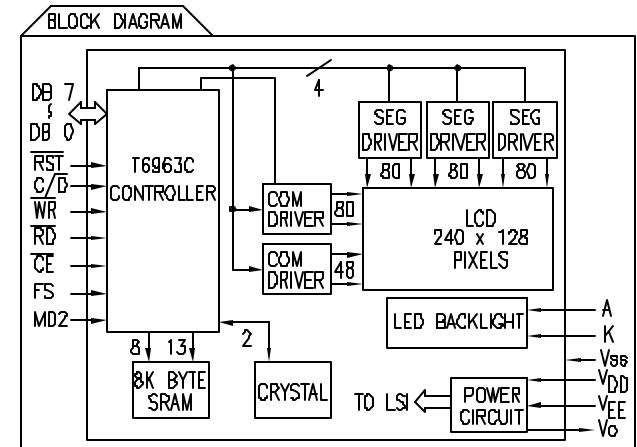

TYPE	DIM.	A	B*	B**	X	Y
REFLECTIVE OR EL		5.2	3.5	8.4	15.24	41.38
LED		10	3.5	8.4	5.08	46.46
CCFL		10	3.5	8.4	-	-

B*: WITHOUT NV+TC.
B**: WITH NV+TC.
NV-NEGATIVE VOLTAGE SUPPLY
TC-TEMPERATURE COMPENSATION

CAUTION: STATIC SENSITIVE DEVICE
FOLLOW PROPER E.S.D. HANDLING PROCEDURES
WHEN WORKING WITH THIS PART.

UNCONTROLLED DOCUMENT
*UNLESS OTHERWISE SPECIFIED TOLERANCE IS ±0.25mm (±0.010")

REV. **B** PART NUMBER **LCM-X240128GXX(-X)**

240 x 128 DOT MATRIX GRAPHIC MODULE,
1/128 DUTY.

CONFIDENTIAL INFORMATION
THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE PROPERTY OF LUMEX INC. EXCEPT AS SPECIFICALLY AUTHORIZED IN WRITING BY LUMEX INC., THE HOLDER OF THIS DOCUMENT SHALL KEEP ALL INFORMATION CONTAINED HEREIN CONFIDENTIAL AND SHALL PROTECT SAME IN WHOLE OR IN PART FROM DISCLOSURE AND DISSEMINATION TO ALL THIRD PARTIES.

RELIABILITY NOTE
OUR MANY YEARS OF EXPERIENCE DATA ACCUMULATION INDICATE THAT SOLDER HEAT IS A MAJOR CAUSE OF EARLY AND FUTURE FAILURE. PLEASE PAY ATTENTION TO YOUR SOLDERING PROCESS.

LUMEX
INCORPORATED

290 E. HELLEN ROAD
PALATINE, ILLINOIS 60067
PHONE: 1-847-359-2790
WEB: HTTP://WWW.LUMEX.COM

DRAWN BY:	CHECKED BY:	APPROVED BY:	DATE: 7-17-98
			PAGE: 1 OF 2
			SCALE: N/A

SA/OU